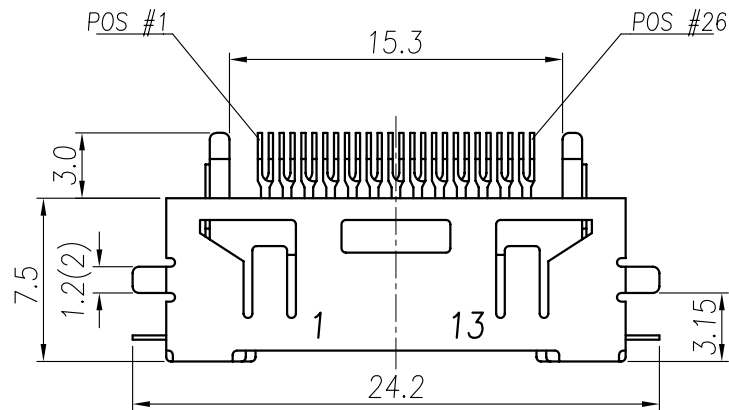





備註 /NOTE:

1. 材質 /MATERIAL:

- 1-1. 針 /PIN: 磷銅 /PHOSPHOR BRONZE
- 1-2. 鐵殼 /SHIELD: 銅合金 /COPPER ALLOY
- 1-3. 鎖片 /LOCKING: 銅合金 /COPPER ALLOY
- 1-4. 膠芯 /HOUSING: THERMALPLASTIC UL94V-0

2. 電鍍 /PLATING:

- 2-1. 針 /PIN: UNOER-PLATE NICKEL ALL OVER, TIN/LEAD ON TAIL ZONE, PLATE (TABLE A) Min GOLD OVER Pd/Ni ON CONTACT AREA.

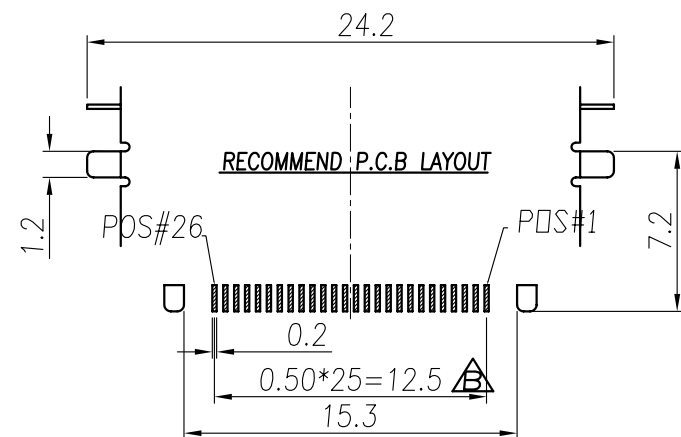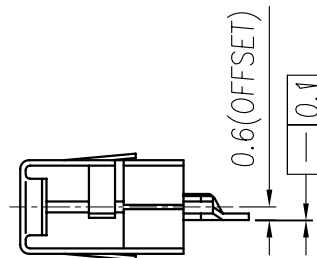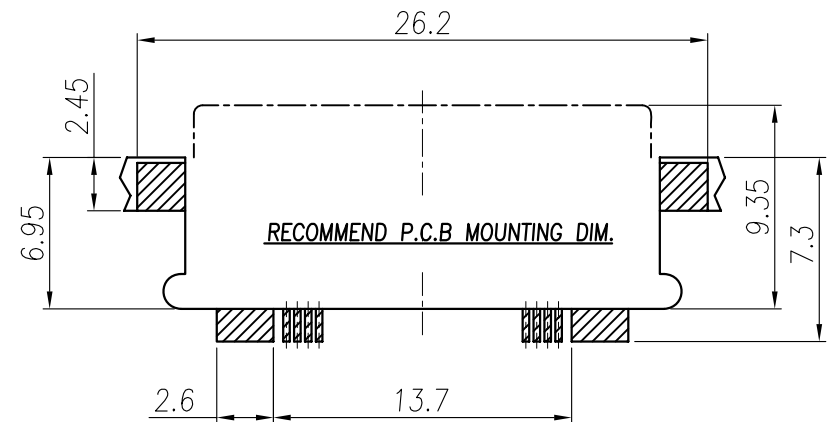

RoHS Compliant

TOLERANCES ARE

MORETHANALL
PCB CONNECTORS
Cable ASSEMBLIES

煜倫股份有限公司

www.morethanall.com

DRAWING BY CY

CHECKED BY GENIUS

UNIT / mm

SCALE 1 : 1

DATE

SIZE A4

PPOJECTION

X. ±
.X ±
.XX ±
.XXX ±
ANG ±

照片框

ORDER INFORMATION

PCM-JWR-26-LF
SERIES T T LEADFREE
26 WAY
REEL
90°SMT
JACK

DESCRIPTION: PCMCIA 26PIN (M)-6

步驟一:



- 1.將成品一一放入包裝盤內,依同一方向置入.
- 2.包裝方式,如圖所示.
- 3.一個包裝盤700pcs.

步驟二:

- 1.一個紙箱可以裝6個包裝盤.
- 2.每盤700pcs,每箱7000pcs.
- 3.將包裝盤放入防水袋中,包裝完後再封箱.

步驟三:

- 1.用膠帶將紙箱封實.
- 2.將標籤貼於紙箱上.
- 3.外箱尺寸:35cm*35cm*31cm

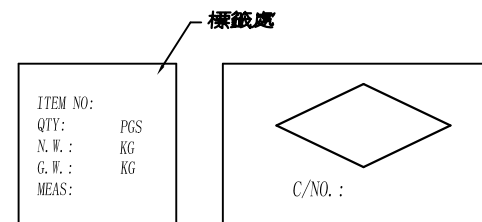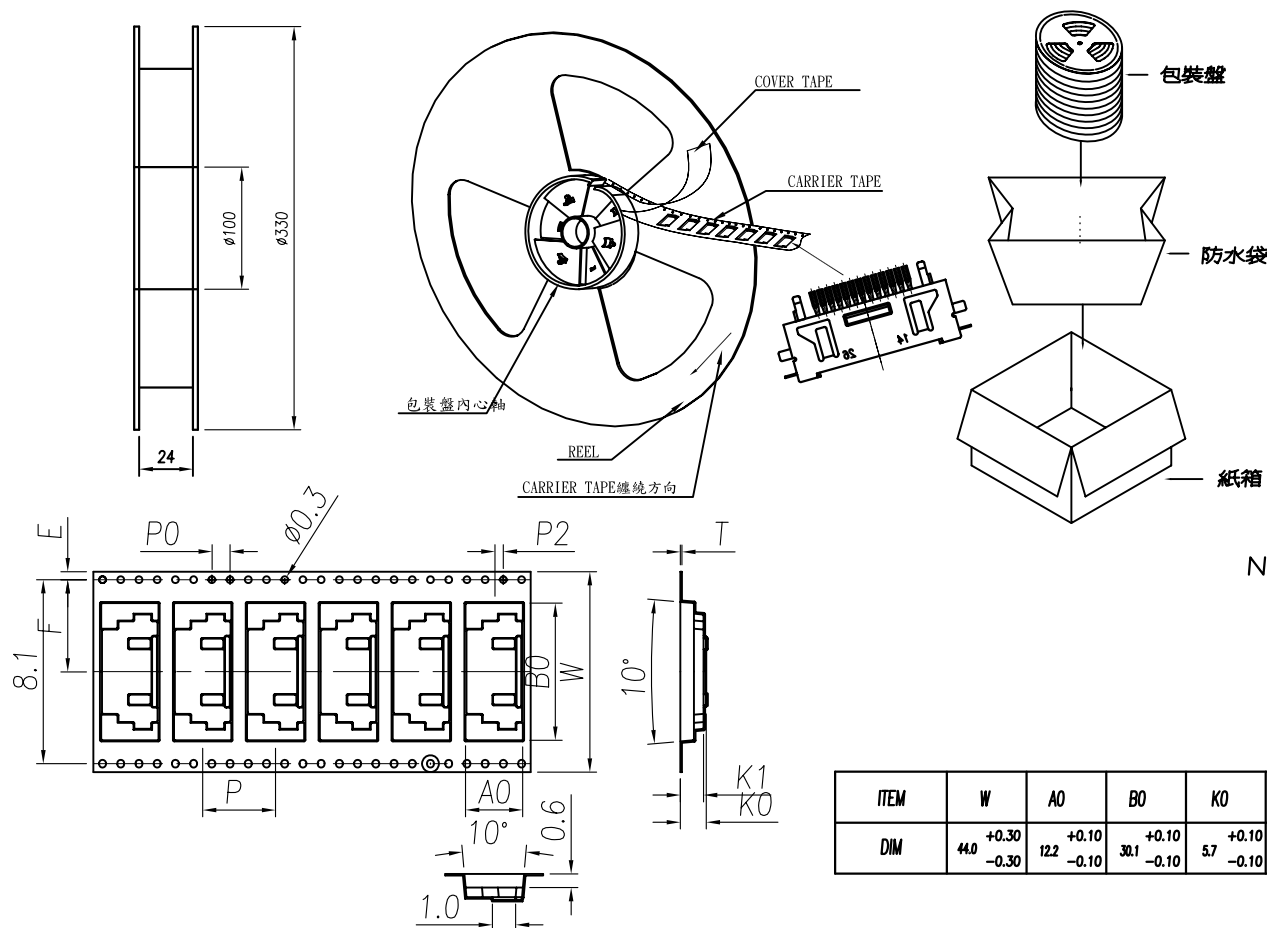

NOTE:

- 1.若有未裝滿之零數箱,必須以緩衝材塞滿.
- 2.在搬運過程中要輕拿輕放.
- 3.載運輸中不可堆放過多,不可有重壓現象.
- 4.在裝滿產品後,必須空留帶前和帶後15格以上,然後用紙膠布貼上.
- 5.上帶在貼下帶時必須平整,且黏貼處不要出現氣泡.

ITEM	W	A0	B0	K0	K1	P	F	E	D0	D1	P0	P2	T
DIM	44.0 +0.30 -0.30	122 +0.10 -0.10	30.1 +0.10 -0.10	5.7 +0.10 -0.10	5.1 +0.10 -0.10	16.0 +0.10 -0.10	20.2 +0.10 -0.10	1.75 +0.10 -0.10	1.5 +0.10 -0.00	0.00 +0.25 -0.00	4.0 +0.10 -0.10	2.0 +0.10 -0.10	0.4 +0.05 -0.05

MORETHANALL
PCB CONNECTORS
Cable ASSEMBLIES

煜倫股份有限公司

www.morethanall.com

RoHS Compliant

DRAWING BY CY

CHECKED BY GENIUS

UNIT / mm SCALE 1 : 1

DATE

SIZE A4

TOLERANCES ARE

X, ±
X ± 0.20
.XX ± 0.10
.XXX ± 0.05
ANG ± 1°

PPOJECTION

照片框

ORDER INFORMATION

PCM-JWR-26-LF
SERIES T T LEADFREE
26 WAY
REEL
90°SMT
JACK

DESCRIPTION: PCMCIA 26PIN A TYPE (F)